


ANILOX ROLL QUALITY CONTROL REPORT

Customer:	Clean Solutions Group		
Your reference:	Anilox roll AB62510		
Our reference:	BB20/3202	Date:	05/02/2026 - 09:35
Ink system:	☐ Doctor blade chamber ☐ Rubber roll		
Type of anilox roll:	☐ Ceramic coated ☐ Hard chrome plated		
Nominal volume:		Cm³/m²	Screen: 40 L/CM
Screen type:	☐ Hexagonal ☐ Diamant ☐ Hex long ☐ GTT ☐ Hashure		
Screen angle:	☐ 30° ☐ 45° ☐ 60° ☐ 75° ☐ 90°		
Screen condition:	☐ Excellent ☐ Good ☐ Fair ☐ Poor ☐ Extremely bad		
Remarks:	☐ Scorelines ☐ metal ☐ calcium ☐ damages ☐ undercorrosion		
Body length:	748	mm	
Volume before cleaning:	13.2	Cm³/m²	after cleaning: 18.3 Cm³/m²

Roll Information, before cleaning.

Cell Info:
Opening: 173.3 **µm**
Wall: 24.42 **µm**
Depth: 43 **µm**

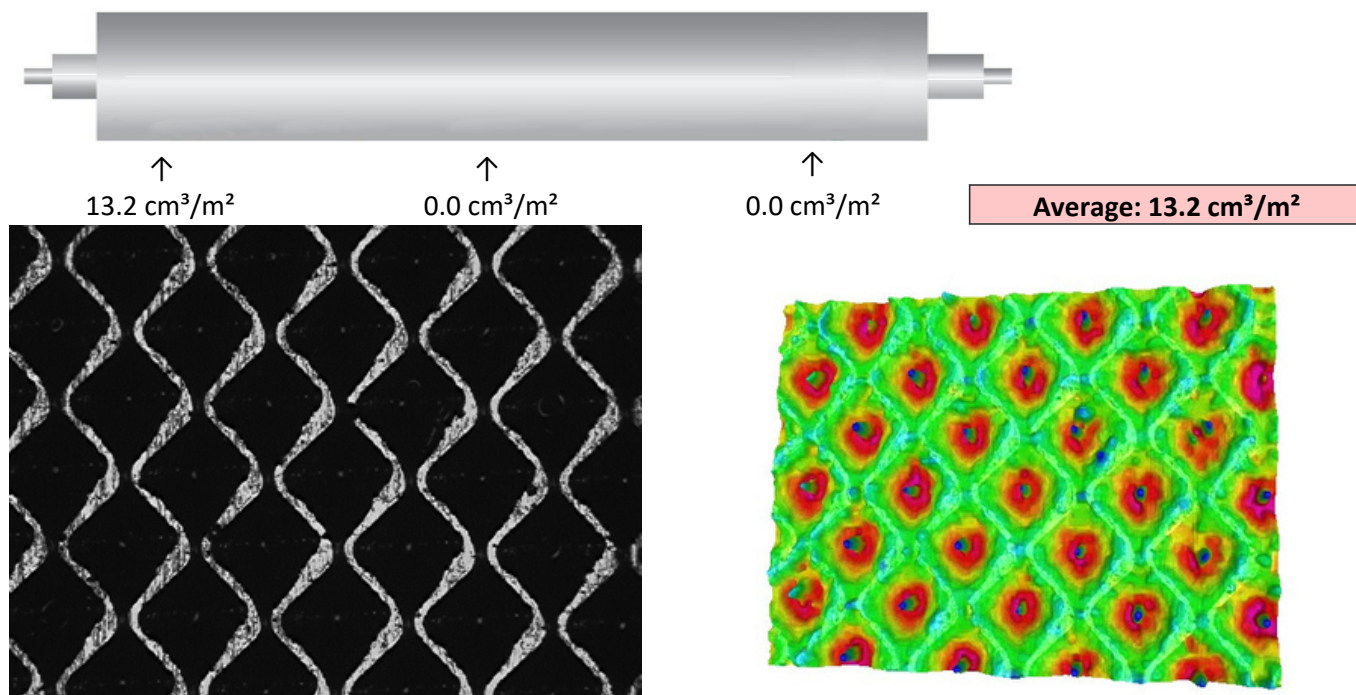

Roll Information, after cleaning.

Cell Info: Opening: μm Wall: μm Depth: μm




↑
18.3 cm^3/m^2

↑
0.0 cm^3/m^2

↑
0.0 cm^3/m^2

Average: 18.3 cm^3/m^2
(38.6%)

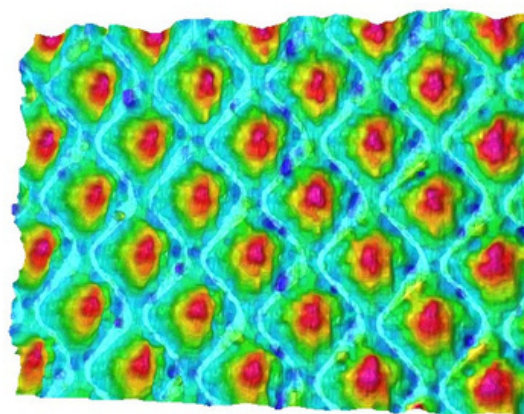

Advise for renewal months: ☐ < 3 ☐ < 6 ☐ 12 ☐ > 12 ☐ no need

Advise Cleaning Liquid: BIOCLEAN GLUEROLL CLEANER

Extra action needed: CLEAN MINIMUM 4 x per year to avoid damages to cell walls!!! Lot of scratches and small damages!

- ☐ Monitoring each month / ☐ Doctor Blade chamber check / ☐ Calcium treatment / ☐ Emergency kit
☐ Magnet and filter to prevent score lines / ☐ heating tank treatment / ☐ worn check by AniCAM

Report made by:

For more information, please contact us:

Clean Solutions Group
 Sigarenmaker 2 5
 521 DJ Eersel
 The Netherlands

Phone: +31 (0)162 576 222
 E-mail: customerservice@cleansolutionsgroup.eu